




USKC32-16-16-F

Ruland USKC32-16-16-F, 1" x 1" Single Universal Joint, Needle Bearing, Steel, Set Screw With Keyway, 1.995" OD, 5.500" Length

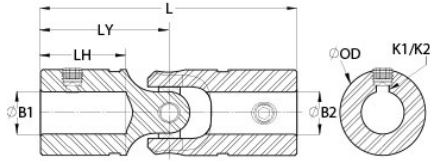

Description

Ruland USKC32-16-16-F is a single cardan needle bearing universal joint with 1.0000" x 1.0000" bores, 1/4" x 1/4" keyways, 1.995" OD, 5.500" length, and 3/8-16 set screws. It is ideal for applications where higher accuracy, service life, and speed are required. This needle bearing universal joint is comprised of needle roller bearings, precision machined trunnions with hardened and ground journals, and two yokes for reduced friction and increased performance in high performance applications. USKC32-16-16-F is designed for use in high RPM applications up to 6000 RPM and has extended service life due to pre-lubricated maintenance free bearings. It is made from high grade alloy steel for durability and high strength. When combined with bootUBOOT32/51-NI-KIT the joint is protected from unwanted contaminants such as dust or water and self lubricates reducing maintenance time. This single cardan universal joint is manufactured in the USA by Belden Universal for strict control of processes.

Product Specifications

Bore (B1)	1.0000 in	Small Bore (B2)	1.0000 in
Keyway (K1)	1/4 in	Keyway (K2)	1/4 in
B1 Max Shaft Penetration	1.700 in	B2 Max Shaft Penetration	1.700 in
Joint Outer Diameter (OD)	1.995 in	Bore Tolerance	+0.0010 in / -0.0000 in
Length (L)	5.500 in	Yoke Length (LY)	2.750 in
Hub Depth (LH)	1.700 in	Broached Set Screw	3/8-16
Screw Material	Alloy Steel	Screw Finish	Black Oxide
Max Operating Angle	45°	Material Specification	Alloy Steel
Manufacturer	Belden Universal	Country of Origin	USA
Weight (lbs)	2.940000	Recommended Lubricant	LUBRIPLATE No. 1200-2
Matching Boot Cover	UBOOT32/51-NI-KIT	UPC	634529290422
Tariff Code	8483.60.4000	UNSPC	25173810
Note 1	Performance ratings are for guidance only. The user must determine suitability for a particular application.		
Prop 65	⚠️ WARNING This product can expose you to the chemical Ethylene Thiourea, known to the State of California to cause cancer and birth defects or other reproductive harm. For more information go to www.P65Warnings.ca.gov .		